

Release Note CODESYS V3.5 SP15 Patch 1

19.09.2019

1 Release Notes

Key	Summary	Release Note	Component/s
CDS- 67712	CODESYS Gateway Win32/x64: Add Edge functionality	[[GENERAL]] We strongly recommend to replace all existing CODESYS Edge Gateway - BETA VERSIONs by the CODESYS Gateway V3.5.15.10 or higher.	Gateway Server
CDS- 62029	Active content in library documentation may be used to execute hostile code	[[GENERAL]] For more details see Advisory 2019-05, which is available on the CODESYS website: https://customers.codesys.com/fileadmin/d ata/customers/security/2019/Advisory2019-05_CDS-62029.pdf JavaScript included in the library documentation is only executed anymore, if the library was sigend with a valid certificate.	CODESYS
CDS- 63096	Compiler, DevApp: Persistent variable configuration is lost after import	[[GENERAL]] Applications which are removed are not automatically deleted from the persistent variable configuration anymore. Instead a new button is available which can be used to clear unknown or deleted applications manually from the persistent variable configuration.	CODESYS
CDS- 63576	Compiler: No compile issue if a action and a fb_instance has the same name	[[GENERAL]] The new warning C0508 is reported when a local variable shadows a local method or action in a POU. Compilerversion >= 3.5.15.0	CODESYS
CDS- 64543	WebVisu: Specific request crashes WebServer with an exception	[[GENERAL]] For more details see Advisory 2019-01, which is available on the CODESYS website: https://customers.CODESYS.com/fileadmin/data/customers/security/2019/Advisory2019-01_CDS-64543.pdf	CODESYS
CDS- 65020	BACnet: CmpBACnet - wrong declaration of IEC_BACNET_STRING.UNI	[[COMPATIBILITY_INFORMATION]] Fixed wrong declaration of BACNET_STRING.data.wstringData.	CODESYS



	ON_BACNET_STRING.wstri ngData	BACNET_STRING.data.wstringData is relevant for DBCS- and UCS-2 encoding, which are not supported right now. No matter of that, the problem needed to be fixed to prevent later API changes if those encodings should be supported in the future. Fixing BACNET_STRING results in API signature changes for bacnetreinitializedevice bacnetrestorebacnetdevice bacnetlifesafetyoperation bacnetconftextmessage bacnetunconftextmessage bacnetunconftextmessage bacnetonfeventnotification bacnetdevicecommcontrol bacnetunconfeventnotification bacnetihaveex bacnetacknowledgealarm	
		bacnetfindupdateobjectidnamebindings bacnetdeleteobjectidnamebindings bacnetbackupbacnetdevice bacnetdoesobjectnameexist bacnetacknowledgeinternalalarm bacnetwhohas bacnetwritegroup	
CDS- 65993	BACnet: CmpBACnet - remove BACnetReadPropertyConditional	[[COMPATIBILITY_INFORMATION]] ReadPropertyConditional has been removed from the standard so the according method BACnetReadPropertyConditional was removed from CmpBACnet.	CODESYS
CDS- 66215	Update SoftMotion to 4.5.1.0	[[GENERAL]] CODESYS SoftMotion is updated to version 4.5.1.0	CODESYS
CDS- 47439	SysFileWin32, SysFileOpen: It should be possible to specify a share mode when opening a file	[[COMPATIBILITY_INFORMATION- EndUser]] SysFileDelete() under Windows (Control Win and Control RTE) works now, if the file is still opened! In this case the file will be deleted really on the filesystem, if the last open handle is closed on the file!	CODESYS Control
CDS- 51688	Control Win: Disable usage of multiple instances on one hardware	[[COMPATIBILITY_INFORMATION- EndUser]] License for CODESYS Control Win cannot be used anymore for several instances of the runtime! So the license is only valid for one instance.	CODESYS Control
CDS- 54035	CmploMgr: Avoid long locks in ReadInputs / WriteOutputs	[[COMPATIBILITY_INFORMATION-OEM]] There is a new feature for IO-drivers to do	CODESYS Control



		the synchronization itself and not by the IoManager. NOTE: Exisiting IO-drivers worked like before! There is no change in the existing behavior! To use this feature, an IO-driver can specify the following new property: #define DRVPROP_NO_SYNC 0x0080 Two new interfaces in CmploMgrltf can be used afterwards to do own synchronization: - IoMgrLockEnter() - IoMgrLockLeave() See IoMgrltf for details.	
CDS- 56119	Hilscher CIFX SDK - CmpHilscherCIFX: Separation from the runtime kernel and move to Contrib repository	[[COMPATIBILITY_INFORMATION-OEM]] Hilscher cifX Toolkit is separated now from the runtime kernel files to: \$\Components_Contrib_\HilscherCifxToolkit So perhaps your build process must be adapted here!	CODESYS Control
CDS- 56660	Update Hilscher CIFX Toolkit to v1.4.0.0	[[COMPATIBILITY_INFORMATION-OEM]] Hilscher cifX toolkit is upgraded now to v1.4.0.0! Additionally the CIFX_TOOLKIT_PARAMETER_CHECK is enabled by default (see OS_Includes.h)! Can be disabled with the macro CIFX_TOOLKIT_PARAMETER_CHECK_ DISABLE.	CODESYS Control
CDS- 60925	CAAFile: issues with Exclusive mode of FILE.open	[[COMPATIBILITY_INFORMATION-EndUser]] Parameter xExclusive in CAA_File.library::Open functionblock cannot be supported, because our targets only support POSIX behaviour! And here a file can be deleted or renamed during it is still opened. And a file can be opened several times (for reading and writing).	CODESYS Control
CDS- 64663	WebServer: Specific directory traversal access possible	[[GENERAL]] For more details see Advisory 2019-01, which is available on the CODESYS	CODESYS Control



		website: https://customers.CODESYS.com/fileadmi n/data/customers/security/2019/Advisory2 019-01_CDS-64543.pdf	
CDS- 64867	CmpSettings: Not allowed character in SetStringValue	[[COMPATIBILITY_INFORMATION]] Settings in the CODESYSControl.cfg File: From now on "=" characters are allowed in the values of settings of the type string. The first "=" character in a line is the delimiter between the key and the value.	CODESYS Control
CDS- 65080	CmpOPCUAServer: Crash if invalid request is sent	[[GENERAL]] For more details see Advisory 2019-07, which is available on the CODESYS website: https://customers.codesys.com/fileadmin/d ata/customers/security/2019/Advisory2019-07_CDS-65080.pdf	CoDeSys Control
CDS- 65149	CODESYS Control: Possible DoS vulnerability of communication servers	[[GENERAL]] For more details see Advisory 2019-06, which is available on the CODESYS website: https://customers.codesys.com/fileadmin/d ata/customers/security/2019/Advisory2019-06_CDS-65149.pdf	CoDeSys Control
CDS- 65459	CmpEventMgr: Reentrant calls of the same callback from different task contexts not possible	[[COMPATIBILITY_INFORMATION-OEM]] Callback functions registered for events are now called concurrently. That means that if a callback function registered for an event is currently being executed and the event is triggered again, then the callback function will be called again concurrently. Therefore, the developer of a callback function is now responsible for making its implementation reentrant. In addition, the developer of a callback function is responsible for avoiding recursive triggering of the event within its registered callback function.	CODESYS Control
		[[COMPATIBILITY_INFORMATION-EndUser]] Callback functions registered for events are now called concurrently. That means that if a callback function registered for an event is currently being executed and the event is triggered again, then the callback function will be called again concurrently.	



000		Therefore, the developer of a callback function is now responsible for making its implementation reentrant. In addition, the developer of a callback function is responsible for avoiding recursive triggering of the event within its registered callback function.	
CDS- 65847	Incorrect permission inheritance for file system objects	[[GENERAL]] For more details see Advisory 2019-04, which is available on the CODESYS website: https://customers.codesys.com/fileadmin/d ata/customers/security/2019/Advisory2019-04_CDS-65847.pdf	CoDeSys Control
		Was already fixed by CDS-58163 for version V3.5.13.0 and now newly assessed.	
CDS- 66221	CmpLog: Support of logger timestamps in console and file in ISO8601 format	[[COMPATIBILITY_INFORMATION]] The timestamp of the logger is now changed in the console windows and the logfiles to ISO8601 format: Format: YYYY-MM-DDThh:mm:ss.mmmZ - YYYY=year - MM=month - DD=day - T=delimiter - hh=hour - mm=minutes - ss=seconds - mmm: milliseconds - Z=zulu time / UTC	CODESYS Control
CDS- 66341	VxWorks: Add -std=c99 compiler setting to VxWorks GNU builds	[[COMPATIBILITY_INFORMATION-OEM]] The previously used ANSI / C89 C standard GNU compiler option for building the CODESYS control runtime for WindRiver VxWorks has been adjusted to support now C99 C standard extensions in the CODESYS control runtime C/C++ sources. (For further information about ANSI C99 support please refer to the CODESYS Control V3 Manual - Chapter Coding Guidelines)	CoDeSys Control
CDS- 67157	WinCE: Huge Cycle Time deviation when calling LogAdd.	[[COMPATIBILITY_INFORMATION-OEM]] From Version 3.5. SP15, the Windows CE runtime system has changed its default behaviour regarding logging.	CoDeSys Control



		Now logger messages are dumped (written to files) asychronouosly, in older versions they were dumped immediately. This behaviour can be overwritten through the CODESYSControl.cfg file option: [CmpLog] Logger.nnn.Type=0x2404 (the bit with value 0x0400 must be set for dumping immediately) Reading the comments regarding logger options in the Windows CE template configuration file in the runtime system deliveries is strongly recommended! For normal production, systems should be configured with dumping asychronously, and the file backend should also be deactivated. [[COMPATIBILITY_INFORMATION-EndUser]] From Version 3.5 SP15, the Windows CE runtime system has changed its default behaviour regarding logging. Now logger messages are dumped (written to files) asychronouosly, in older versions they were dumped immediately. This behaviour can be overwritten through the CODESYSControl.cfg file option: [CmpLog] Logger.nnn.Type=0x2404 (the bit with value 0x0400 must be set for dumping immediately) If possible, have a look at the logger options in the Windows CE runtime system configuration file (CODESYSControl.cfg) For normal production, systems should be configured with dumping asychronously, and the file backend should also be deactivated.	
CDS- 14320	SysCom: wrong datatype for bRTSControl and bDtrControl, has to be BYTE	[[COMPATIBILITY_INFORMATION-OEM]] The structure COM_SettingsEx has been changed in SysComItf.h! The structure remains binary compatible, but the following 2 parameters are changed: - bDtrControl -> byDtrControl and the type from BOOL -> BYTE - bRtsControl -> byRtsControl and the type from BOOL -> BYTE	CODESYS Control, Libraries
CDS- 63686	Visu, Meter: Element draws bigger than configured	[[GENERAL]] Requires Visu-Profil >= 3.5.15.0	CODESYS, Libraries



		[[COMPATIBILITY_INFORMATION- EndUser]] The size and location of the meter is slightly changed due to a bug in the painting of the element	
CDS- 64208	Gateway: Insufficent check of service header	[[GENERAL]] For more details see Advisory 2019-03, which is available on the CODESYS website: https://customers.CODESYS.com/fileadmin/data/customers/security/2019/Advisory2019-03_CDS-64208.pdf	Gateway Server
CDS- 65123	Gateway: GatewaySession could be hijacked	[[GENERAL]] For more details see Advisory 2019-02, which is available on the CODESYS website: https://customers.CODESYS.com/fileadmin/data/customers/security/2019/Advisory2019-02_CDS-65123.pdf	Gateway Server
CDS- 65124	Gateway: Channel number uses insufficiently random values	[[GENERAL]] For more details see Advisory 2019-02, which is available on the CODESYS website: https://customers.CODESYS.com/fileadmin/data/customers/security/2019/Advisory2019-02_CDS-65123.pdf	Gateway Server
CDS- 21761	Linux CAA File: Renaming of files and directories is possible even though they are still opened	[[COMPATIBILITY_INFORMATION]] Contrary to the original CAA specification the renaming of files and directories is possible even if they are opened! This behavior is dependent of the underlying operating system and file system.	Libraries
CDS- 21762	Linux CAA File: Removing of files is possible even though they are still opened	[[COMPATIBILITY_INFORMATION]] Contrary to the original CAA specification the deletion of files and directories is possible even if they are opened! This behavior is dependent of the underlying operating system and file system.	Libraries

2 Known Limitations

Reboot required to restart a VxWorks PLC

Due to the restriction that the OpenSSL stack can't be re-initialized, it is no more possible to re-start a PLC under VxWorks, if the component CmpOpenSSL is included in the runtime. In such a case, if the PLC has to be re-started, a complete reboot of the hardware is necessary.



3 OEM information from JIRA

To read up on implemented features and changes you can use your JIRA account. Please find some **example** filters below.

List of features and changes:

fixVersion = "V3.5 SP15 Patch 1" fixVersion = "V3.5 SP15 Patch 1" AND issuetype = "New Feature"

List of features and changes since CODESYS V3.5 SP15:

fixVersion IN ("V3.5 SP15 Patch 1", "V3.5 SP15")

List of issues with compatibility information and known limitations:

fixVersion = "V3.5 SP15 Patch 1" AND (text ~ COMPATIBILITY_INFORMATION OR text ~ KNOWN_LIMITATIONS)

4 History

Created: Chris Trommeshauser (Quality Assurance)
Reviewed: Sebastian Rothärmel (Quality Assurance)
Released: Sebastian Rothärmel (Quality Assurance)